


# 產品尺寸圖 ( DIMENSION )

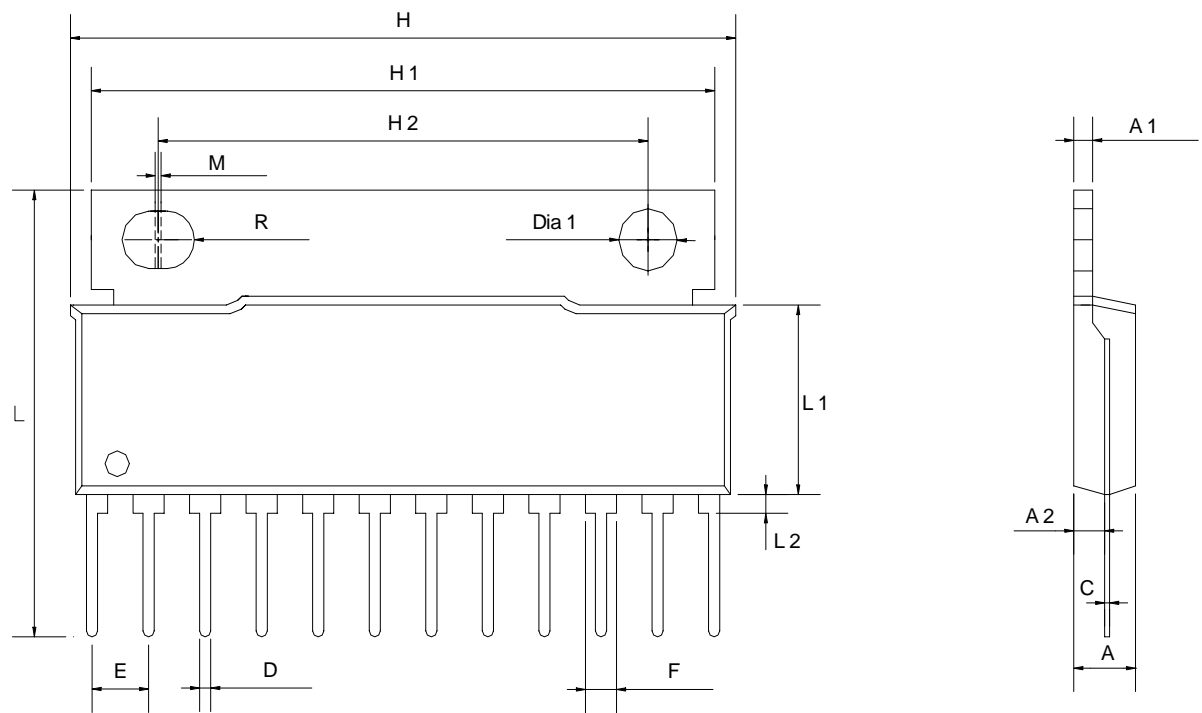

Symbol	Dimensions In Millimeters			Dimensions in Inches		
	Min	Nom	Max	Min	Nom	Max
A	3.20	-	3.80	0.126	-	0.150
A1	1.10	-	1.30	0.043	-	0.051
A2	1.65	-	1.95	0.065	-	0.077
C	0.20	-	0.35	0.008	-	0.014
D	0.55	-	0.75	0.022	-	0.030
E	2.44	-	2.64	0.096	-	0.104
F	1.20	-	1.40	0.047	-	0.055
H	29.40	-	30.10	1.157	-	1.185
H1	27.60	-	28.40	1.087	-	1.118
H2	19.70	-	20.30	0.776	-	0.799
L	21.40	-	22.50	0.843	-	0.886
L1	7.40	-	8.00	0.291	-	0.315
L2	1.00	-	1.40	0.039	-	0.055
M	0.50	-	0.70	0.020	-	0.028
R	1.80	-	1.90	0.071	-	0.075
Dia1	3.50	-	3.80	0.138	-	0.150

Note : QC. Inspection Range : A,C,D,H,H1,L1

PACKAGE	HSIP-12A	
DRAWING NUMBER	DIM-HSIP12A-0507-A	
SIGNATURE	製圖	莊立德
	審核	王啓任
	核准	許敏龍